

HOLEMAKER PRO 35

Holemaker Portable Magnetic Drilling Machine

OPERATOR'S MANUAL

WARNING!

BEFORE USE, ENSURE EVERYONE USING THIS MACHINE READS AND UNDERSTANDS
ALL SAFETY AND OPERATING INSTRUCTIONS IN THIS MANUAL .



EYE PROTECTION
REQUIRED



HEARING PROTECTION
REQUIRED



NEVER PLACE
FINGERS NEAR
CUTTING AREA OR
MACHINE ARBOR



LINE VOLTAGE
PRESENT



BEWARE OF
ROTATING
MACHINE PARTS



Serial # _____

Date of Purchase _____

Holemaker PRO 35 Portable Magnetic Drilling Machine

Congratulations on the purchase of your Holemaker Pro 35 portable magnetic drilling machine. Holemaker drilling machines are designed to deliver fast, efficient hole drilling performance in portable applications.

TABLE OF CONTENTS

Important Safety Instructions	3-4
Power Supply Requirement	5
Technical Data	6
Special Instructions	7
Contents of Package	7
Machine Operation	8-10
Maintenance and Service	11
Basic Troubleshooting	12
Machine Parts Breakdown	13 - 19
Electrical Diagram	20

LIMITED WARRANTY

Industrial Tool & Machinery Sales (hereinafter referred to as ITMS) will, within twelve (12) months from the original date of purchase, repair or replace any goods found to be defective in materials or workmanship. This warranty is void if the item has been damaged by accident, neglect, improper service or other causes not arising out of defects in materials or workmanship.

This warranty does not apply to machines and/or components which have been altered, changed, or modified in any way, or subjected to overloading or use beyond recommended capacities and specifications. Worn componentry due to normal wear and tear is not a warranty claim.

Goods returned defective shall be returned prepaid freight to ITMS or agreed repair agent, which shall be the buyer's sole and exclusive remedy for defective goods. ITMS accepts no additional liability pursuant to this guarantee for the costs of travelling or transportation of the product or parts to and from ITMS or the service agent or dealer, such costs are not included in this warranty.

Our goods come with guarantees which cannot be excluded under the Australian Consumer Law. You are entitled to replacement or refund for a major failure and to compensation for other reasonably foreseeable loss or damage. You are also entitled to have the goods repaired or replaced if the goods fail to be of acceptable quality and the failure does not amount to a major failure.

THE MANUFACTURER RESERVES THE RIGHT TO MAKE
IMPROVEMENTS AND MODIFICATIONS TO DESIGN WITHOUT PRIOR NOTICE.

Imported And Distributed By

INDUSTRIAL TOOL & MACHINERY SALES

18 BUSINESS ST, YATALA, QLD AUSTRALIA 4207

PHONE 07 3287 1114 FAX 07 3287 1115

sales@industrialtool.com.au www.industrialtool.com.au

IMPORTANT SAFETY INSTRUCTIONS



WHEN USING ELECTRICAL TOOLS, BASIC SAFETY PRECAUTIONS SHOULD ALWAYS BE FOLLOWED
TO REDUCE RISK OF FIRE, ELECTRIC SHOCK AND PERSONAL INJURY .

READ AND SAVE ALL INSTRUCTIONS FOR FUTURE REFERENCE.

1. Keep Work Area Clean
 - Cluttered areas and benches increase risk of injuries.
2. Consider Work Area Environment
 - Do not expose power tools to rain.
 - Do not use power tools in damp or wet locations.
 - Keep work area well lit.
 - Do not use tool in presence of flammable liquids or gases.
3. Guard Against Electric Shock
 - Prevent body contact with grounded surfaces. For example: pipes, radiators, ranges and refrigerator enclosures.
4. Keep Children Away
 - Do not let visitors contact tool or extension cord.
 - All visitors should be kept away from work area.
5. Store Idle Tools
 - When not in use, tools should be stored in a dry, high and locked-up place, out of reach of children.
6. Do Not Force Tool
 - It will do the job better and safer at the rate for which it was intended.
7. Use Right Tool
 - Do not force a small tool or attachment to do the job of a heavy-duty tool.
 - Do not use tool for unintended purpose. For example: Do not use a circular saw for cutting tree limbs or logs.
8. Dress Properly
 - Do not wear loose clothing or jewellery. They can be caught in moving parts.
 - Rubber gloves and non-skid footwear are recommended when working outdoors.
 - Wear protective hair covering to contain long hair.
 - Always wear safety glasses
 - Use face or dust mask if necessary
 - Use hearing protection
9. Do Not Abuse Electrical Cord
 - Never carry tool by cord or yank it to disconnect from receptacle.
 - Keep cord away from heat, oil and sharp edges.
10. Secure Work
 - Use clamps or a vise to hold work. It's safer than using your hand and it frees both hands to operate tool.
11. Do Not Overreach
 - Keep proper footing and balance at all times.

IMPORTANT SAFETY INSTRUCTIONS

12. Maintain Tools With Care
 - Keep tools sharp and clean for better and safer performance.
 - Follow instructions for lubricating and changing accessories.
 - Inspect tool cords periodically and if damaged, have repaired by authorized service facility.
 - Inspect extension cords periodically and replace if damaged.
 - Keep handles dry, clean, and free from oil and grease.
13. Disconnect Tools
 - Unplug when not in use, before servicing, and when changing accessories, such as cutters.
14. Remove Adjusting Keys And Wrenches
 - Form habit of checking to see that keys and adjusting wrenches are removed from tool before turning it on.
15. Avoid Unintentional Starting
 - Do not carry a plugged-in tool. Always disconnect from power source before moving.
 - Be sure switches are off before connecting to a power source.
16. Outdoor Use Of Extension Cords
 - When tool is used outdoors, use only extension cords intended for use outdoors and so marked.
17. Stay Alert
 - Watch what you are doing. Use common sense. Do not operate tool when you are tired.
 - Do not use when taking medications that may cause drowsiness.
18. Check Damaged Parts
 - Before further use of the tool, any damaged parts should be repaired and performance verified prior to operation.
 - Check alignment of moving parts, binding of parts, breakage of parts, mounting, and any other conditions that may affect its operation. Any part that is damaged should be properly repaired or replaced by an authorized service center.
 - Do not use this tool if switches do not turn it on and off. Have defective switches replaced by authorized service center.
19. Use Cutter Guard
 - Always use cutter guard supplied with machine to reduce the risk of injury. (refer fig. 1)

Fig. 1



POWER SUPPLY REQUIREMENTS

Prior to use check condition of the power cord, which has to be free of any cuts, or similar damages.

Attention!: This unit has a class one of insulation and absolutely requires the power source to be equipped with a protection circuit.

Power source should be protected with the difference-current circuit cut-out and protected with a 10A fuse - for 230V. At building sites, power should be supplied from a separation transformer such as Type AVM, with minimum power of 2000 VA and with second class protection.

GROUNDING INSTRUCTIONS

WARNING!

Improperly connecting the grounding wire can result in the risk of electrical shock. Check with a qualified electrician if you are in doubt as to whether the outlet is properly grounded. Do not modify the plug provided with tool. Never remove the grounding prong from the plug. If the cord or plug is damaged, have it repaired before using. If the plug will not fit the outlet, have a proper outlet installed by a qualified electrician. The HOLEMAKER must be plugged into an appropriate outlet, properly installed and grounded in accordance with all codes and ordinances. The plug and outlet should look similar to those in Figure A. If in doubt of proper grounding, call a qualified electrician.

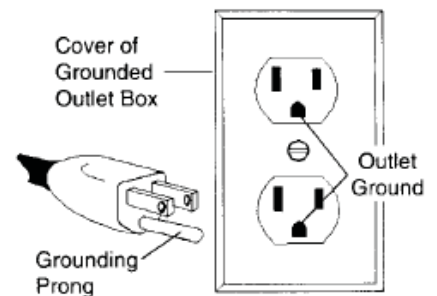


Fig. A

WARNING!

DO NOT USE HOLEMAKER DRILLING MACHINES ON SURFACES OR MATERIALS BEING WELDED. DOING SO CAN RESULT IN DAMAGE TO THE DRILLING MACHINE.

EXTENSION CORDS

Use only 3-wire extension cords that have 3-prong grounding-type plugs and 3-pole receptacles that accept the tool's plug. Replace or repair damaged cords. Make sure your extension cord is in good condition. When using an extension cord, be sure to use one heavy enough to carry the current your product will draw. An undersized cord will cause a drop in line voltage resulting in loss of power and overheating. See table for the correct size to use depending on cord length and nameplate amperage rating. If in doubt, use the next heavier gauge. The smaller the gauge number, the heavier the cord.

MINIMUM GAUGE FOR EXTENSION CORDS				
VOLTS	TOTAL LENGTH OF CORD IN METRES			
240V	0 - 15	15 - 30	30 - 60	60 - 90
AMPERAGE				
0-6	18	16	16	14
6-10	18	16	14	12
10-12	16	16	14	12
12-16	14	12	NOT RECOMMENDED	
RECOMMENDED WIRE GAUGE				

DRIP LOOP: To help prevent cutting fluids from traveling along power cord and contacting power source, tie a drip loop in power cord as shown in Figure C.


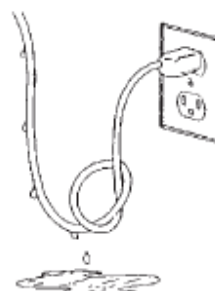


Fig. C

TECHNICAL DATA

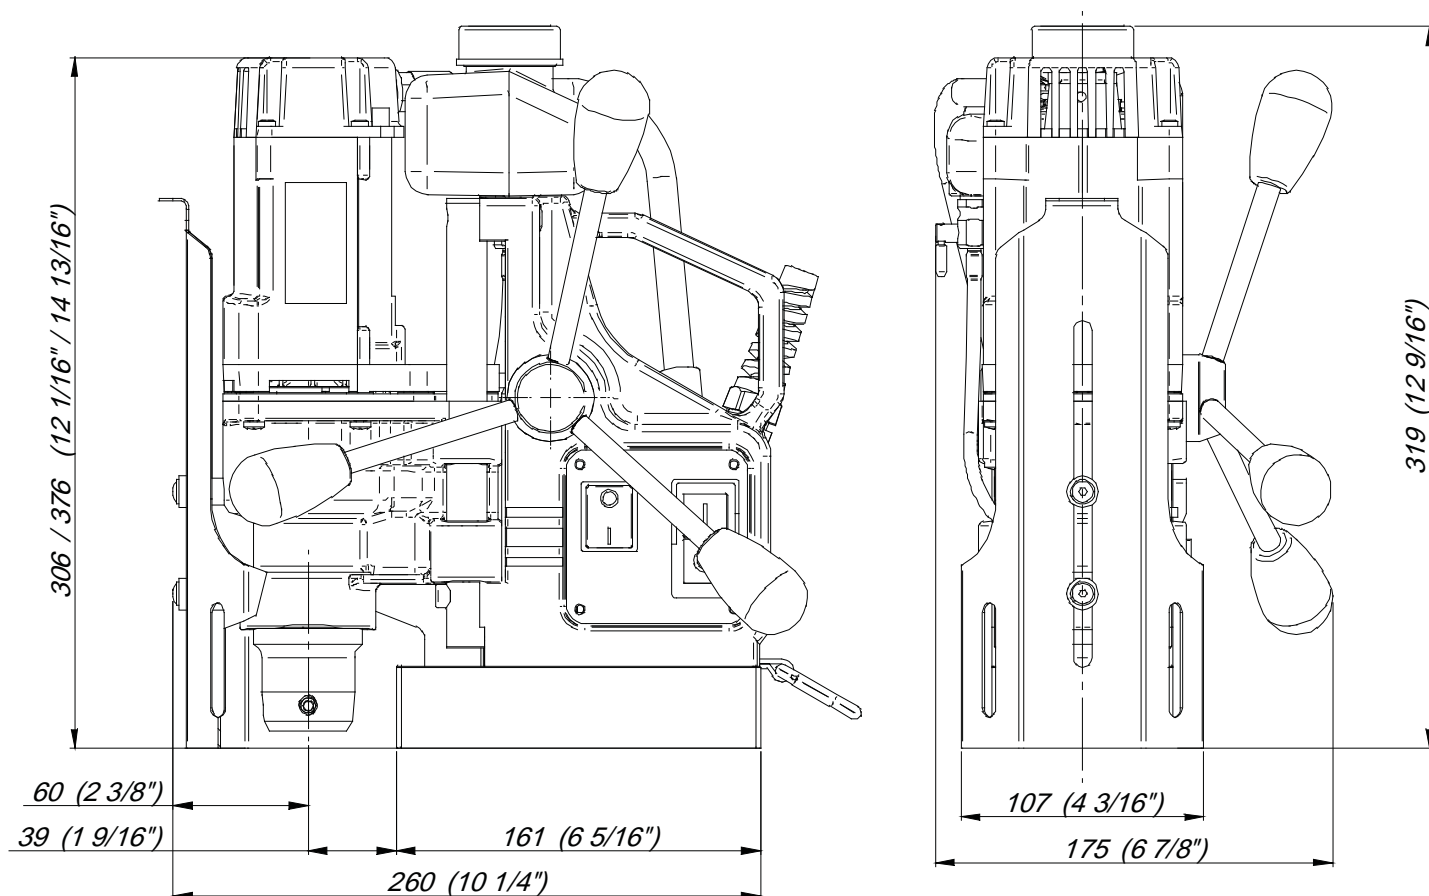

Supply voltage:	220-240V/ 50-60 Hz.
Motor power	920 W
Total power	1000 W
Machine speeds (under load):	350rpm
Insulation class	First
Tool holder	(³ / ₄ " Weldon) 19.05 mm
Capacities: max. Holemaker cutter diameter	35 mm
max. drilling depth with standard arbor	52mm
Magnet Dead Lift (on 25 mm plate)	9500 N
Dimensions:	
electromagnetic base	80x160x36.5 mm
Length of the power cord	3 m
Total weight	10 kg
Noise level	85 dB

SPECIAL INSTRUCTIONS


1. Read and follow operator's manual thoroughly.
2. DO NOT touch rotating cutter or parts.
3. Always stop machine completely and unplug from power source before changing cutters, clearing swarf, refilling lubrication or performing adjustments.
4. Never wear loose clothing or gloves when working near cutting area or machine arbor.
5. Always wear eye protection. Any tool can shatter.
6. Always use safety chain or strap provided with machine.
7. Always use proper tooling. Keep cutters securely fastened.
8. DO NOT use dull or broken cutters.
9. Beware of ejected slugs at end of cut. They become HOT during the cut.
10. Keep all safety features functioning and working properly.
11. Keep bottom of magnet burr free and clear of chips and debris.
12. To reduce the risk of electrical shock, DO NOT remove or alter electrical panels or use machine in damp areas.
13. Use only authorized service centers for repairs.


Remove all contents from packaging and inspect to ensure no damage was incurred during shipping. Your Holemaker package should include the following:


DESCRIPTION	QTY
HOLEMAKER PRO35 MACHINE	1
METAL CARRY CASE	1
SAFETY CHAIN WITH CLIP	1
SAFETY GUARD	1
HEX WRENCH 4	1
SPOKE HANDLE WITH KNOBS	3
COOLANT BOTTLE ASSEMBLY	1
OPERATORS MANUAL	1

WHAT YOU SHOULD KNOW BEFORE YOU DRILL

1. Type of material to be drilled, Brinnell or Rockwell hardness, material thickness and position should all be determined to ensure proper selection of cutting tools.
2. Remove any excessive mill scale or rust from surface to be drilled.
3. When drilling thin materials, it is recommended that you place a steel plate under the work piece and Holemaker magnet area to increase magnetic holding force.
4. Material that has been flame cut may become heat treated and therefore difficult to drill. Avoid drilling near such areas whenever possible.
5. Special cutter lubricant is available for using the Holemaker and annular cutters in the horizontal position. Consult your distributor for more information.


 Caution: Do not drill on material where welding is also simultaneously being performed. Drilling machine will be damaged.

 Caution: Powering drilling machine from generator without proper surge protection device between generator and drilling machine may cause damage to the Printed Circuit Board in machine.

 The Holemaker Pro 35 is not designed for use on steel thinner than 3/8" or 10mm, as the magnet's adhesive power would be significantly reduced which can cause machine failure or individual injury. The machines built in "Smart Magnet Technology" will detect insufficient magnetic adhesion, and will cause the machine's motor on/off button to not engage. Although it is not recommended, this feature can be bypassed by following the attached "Smart Magnet Technology Bypass" instruction leaflet.

START UP AND OPERATION

CAUTION: READ THE WHOLE INSTRUCTIONS MANUAL BEFORE ATTEMPTING TO START UP

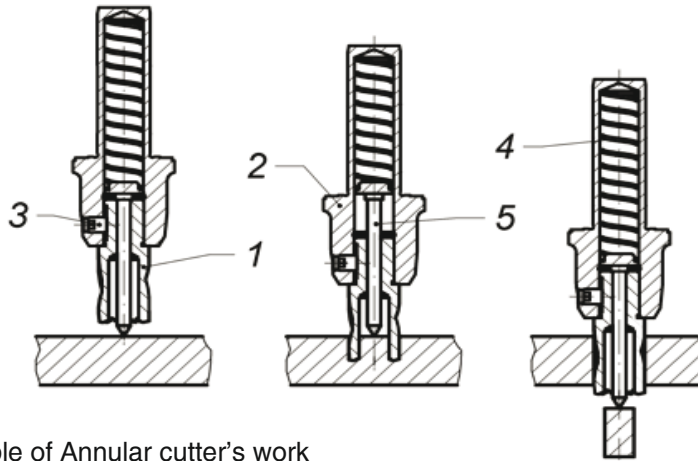

Principle of Annular cutter's work

This drilling machine's spindle has a 19mm Weldon Shank type and is specifically designed for use with Annular cutters.


Annular cutter (1) is located inside arbor body (2) and is fastened with grub screws (3). When fastening the cutter in the arbour, ensure that the grub screws are firmly tightened to avoid them coming loose during operation. It is important to position the cutter in relation to the arbour in such a way that fixing flats on the cutter shank are positioned opposite to the grub screws (3). Both grub screws(3) should be used to fasten the cutter. The Pilot Pin (5) is located inside the cutter to easily position the annular cutter over centre of a planned hole. During drilling as the cutter goes into the material, the pilot pin moves back into the arbour body and pressurizes the discharge spring (4). That spring ejects the slug which is a by-product of drilling the hole with a centre free cutter.

The machine is supplied in a metal box. Some components of the drilling machine are coated with grease film for protection during transit and storage. Prior to use of the machine this should be wiped clean.

CONTROL PANEL

Control elements include:

- Magnet Switch (1),
- Start-Stop Switch (2),

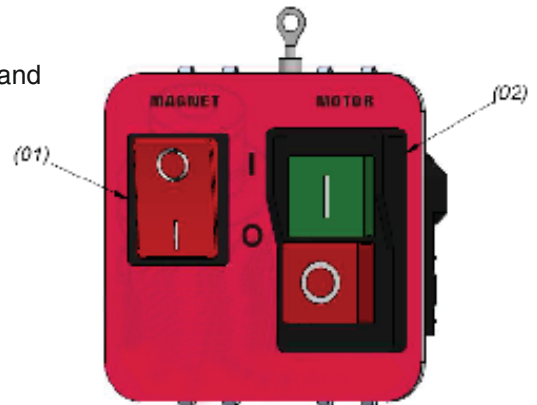

- In order to start the machine press the magnet switch (1) on "I". Now you can start the motor by pressing Start-Stop Switch (2) green button "I"
- Stopping the motor is executed with red button „O” (the motor is switched OFF but the electromagnetic base is still ON).
- To move machine into next drilling spot, stop the motor as described above and push the magnet switch (1) to the position "O".

NOTE: As a power saving function, Switching the Magnet Switch(1) to "I" will supply the electromagnet with 50% power. Switching the Start-Stop Switch(2) to "I" will increase the electromagnet to 100% power.

Before you cut

Before positioning the machine on work piece always make sure that:

- work piece is made of ferrous material
- thickness of work piece is adequate for secure magnetic adhesion (mild steel - 10mm is recommended)
- Ensure no part of magnet overhangs the steel workpiece
- surface of steel under the magnet is flat
- wipe, brush or sand down clean surface where you intended to place the drilling machine, so that you remove rust, paint, dirt etc which would reduce adhesive power of the electromagnetic base.

Install annular cutter in the machine before plugging it into mains.

Place the machine so that the tool is over the centre of the hole you intend to make and turn the magnetic base ON.

Always make sure prior to use that the machine is secured from falling down with a chain/strap.



An example of a safety chain/strap use.

Cutting

- Choose a suitable lubricating fluid and fill the coolant tank.

The cooling system is an integral part of the machine and should always be used.

Warning: The cooling system works gravitationally, therefore it can be used only when in vertical position of the drilling machine. In other positions, a cutting paste should be used

- Check workings of cooling system. Open the coolant tank's tap and apply pressure on the pilot by turning spokes counter clockwise. As the pilot starts to sink into the cutter, cooling liquid should start to run down the groove in pilot pin. If there is no liquid flowing down, check if the tap is fully opened. It may take a few seconds for cooling liquid to fill the whole system.

- Turn the motor on.

Bring the cutter gently into contact with the work piece and slowly start to apply pressure on the cutter.

Making a hole with an annular cutter should ideally be done in one pass.
Do not peck drill.

WARNING : When the annular cutter goes through the material the slug can be pushed out often with considerable strength.
Pay attention to avoid injury.

- After a hole is made the cutter should be retracted and both the motor and the electromagnet should be switched OFF.
- When work with the machine is finished the power cord should be disconnected from the power source, the machine should be cleaned up from swarf, coolant etc and the cutter should be removed and cleaned.


MAINTENANCE AND SERVICE

- Every 250 hours of work check condition of carbon brushes. If their length is less than 5 mm they should be replaced with new genuine brushes. After replacement, new brushes should be run-in without load for about 20 min. Repair and service work is to be performed by authorized service agents only.
- Your Holemaker PRO 35 machine is equipped with a new unique system for elimination of excess play in slide guides. This system completely eliminates the users intervention.
- Keep the magnet clean and free of chips, oil or other contaminants.
- Inspect arbor, sleeve and support bracket for visible wear.
- Replace any worn parts and tighten any fasteners that may have come loose during daily usage.


BASIC TROUBLESHOOTING

1. Magnetic base not holding securely
 - Material is too thin.
 - Surface of material being drilled must be free of chips, debris, rust and mill scale.
 - Does size of cutter exceed machine's rated capacity?
 - Check magnet face for unevenness, nicks and burrs.
2. Drill motor running, arbor and spindle not turning
 - Possible sheared drive train component.
3. Motor slows when drilling
 - Is an extension cord being used? If so, see page 5 for recommended wire gages and cord lengths.
 - Excessive downfeed pressure during drilling cycle will cause motor to slow and overheat.
 - Does cutting tool need to be resharpened?
4. Coolant system not working
 - Coolant system is gravity dependent, machine must be in a upright position to operate properly.
 - Dirt or debris in coolant tank.
 - Consistency of coolant mixture too thick.
 - Is correct pilot pin being used?
 - Vent hole in coolant tank lid blocked.
5. Slugs not ejecting from cutter
 - Lack of coolant causing slugs to expand in cutter bore.
 - Is correct pilot pin being used?
 - Possible broken internal arbor parts.
6. Breaking cutters
 - How is coolant being applied? Coolant must be supplied to interior of cutter.
 - Excessive feed pressure being applied when cutter initially contacts work surface.
 - Confirm material hardness.
 - Drilling stacked materials with incorrect cutter.
 - Dull cutters; dull or chipped cutting edges require excessive feed pressure, resulting in breakage.
 - Movement of machine on material - See "1. Magnetic base not holding securely"
 - Inconsistent hardness in material can cause cutter breakage
7. Oversized or rough holes
 - Insufficient coolant.
 - Excessive feed pressure.
 - Dull cutter.


HMPRO35		MAGNETIC DRILLING MACHINE HOLEMAKER PRO 35	
ITEM	PART NUMBER	DESCRIPTION	QTY
1	SPPRO3501	FRAME ASSEMBLY	1
2	SPPRO3502	GEARBOX ASSEMBLY	1
3	SPPRO3503	MOTOR ASSEMBLY	1
4	SPPRO3504	GUARD ASSEMBLY	1
5	SPPRO3505	COOLANT BOTTLE ASSEMBLY	1
6	SPPRO3506	CONTROL PANEL ASSEMBLY	1
7	SPPRO3507	POWER CORD 230V 3x1,5	1
7.4	SPPRO350704	STRAIN RELIEF PG11	1
8	SPPRO3508	SPOKE HANDLE INCLUDING KNOB (ASSY),	3
9	SPPRO3509	LOWER SLEEVE,	2
10	SPPRO3510	PUSH SPRING,	2
11	SPPRO3511	NYLON WASHER SR1940,	4
12	SPPRO3512	SOCKET BUTTON HEAD CAP SCREW WITH FLANGE M5x20,	2
13	SPPRO3513	CROSS RECESSED RAISED COUNTERSUNK HEAD SCREW M4x16	1
14	SPPRO3514	SPRING WASHER-4.3	1
15	SPPRO3515	HEX NUT M4	2
16	SPPRO3516	SPRING WASHER-4.1	1
17	SPPRO3517	HEX. SOCKET BOLT M6X35	2
18	SPPRO3518	HEX. SOCKET BOLT M6x30	2
19	SPPRO3519	SPRING WASHER 3,7	4
20	SPPRO3520	CROSS RECESSED PAN HEAD TAPPING SCREW 3,5x13	4
21	SPPRO3521	SCREW FOR PLASTIC M5x30	3
22	SPPRO3522	CROSS RECESSED CHEESE HEAD SCREW M5x50	1

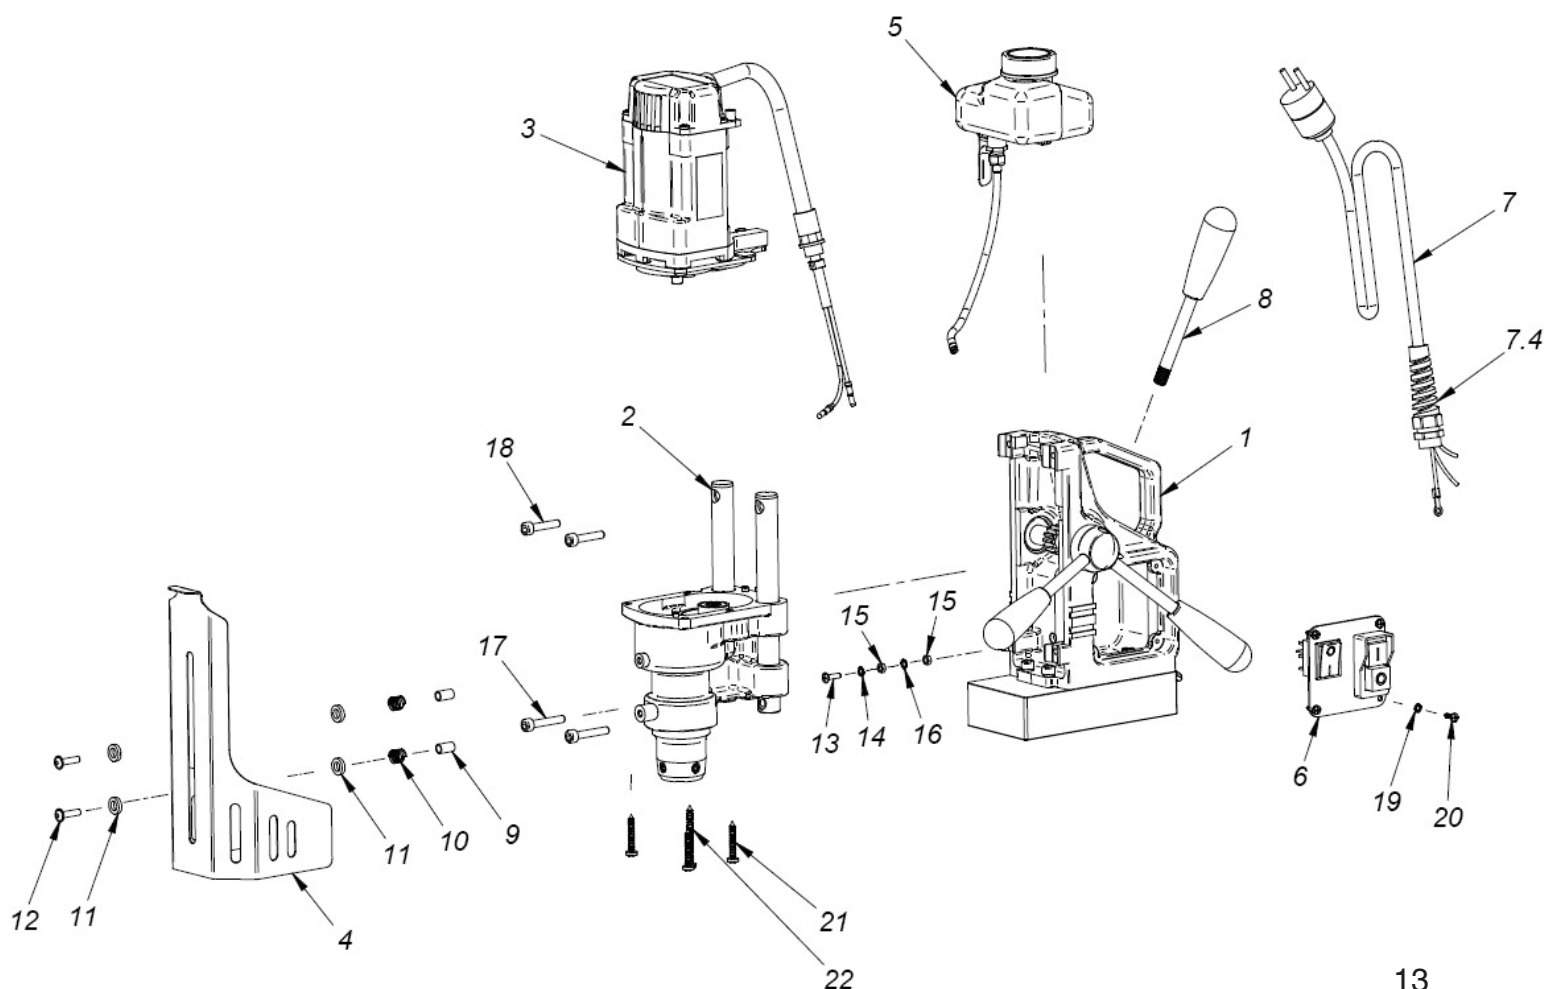


SPPRO3501		FRAME ASSEMBLY	
ITEM	PART NUMBER	DESCRIPTION	QTY
1.1	SPPRO350101	MAIN BODY ASSY	1
1.2	SPPRO350102	PINION SHAFT ASSY z14	1
1.2.1	SPPRO35010201	SEAL QUAD-RING 20,22x3,53	2
1.3	SPPRO350103	D-RING STRAP	1
1.4	SPPRO350104	ELECTROMAGNETIC BASE,	1
1.6	SPPRO350106	SPRING WASHER 6,1	3
1.7	SPPRO350107	EXTERNALE RETAINING RING 28z	1
1.8	SPPRO350108	HEX. SOCKET BOLT M6x20	3

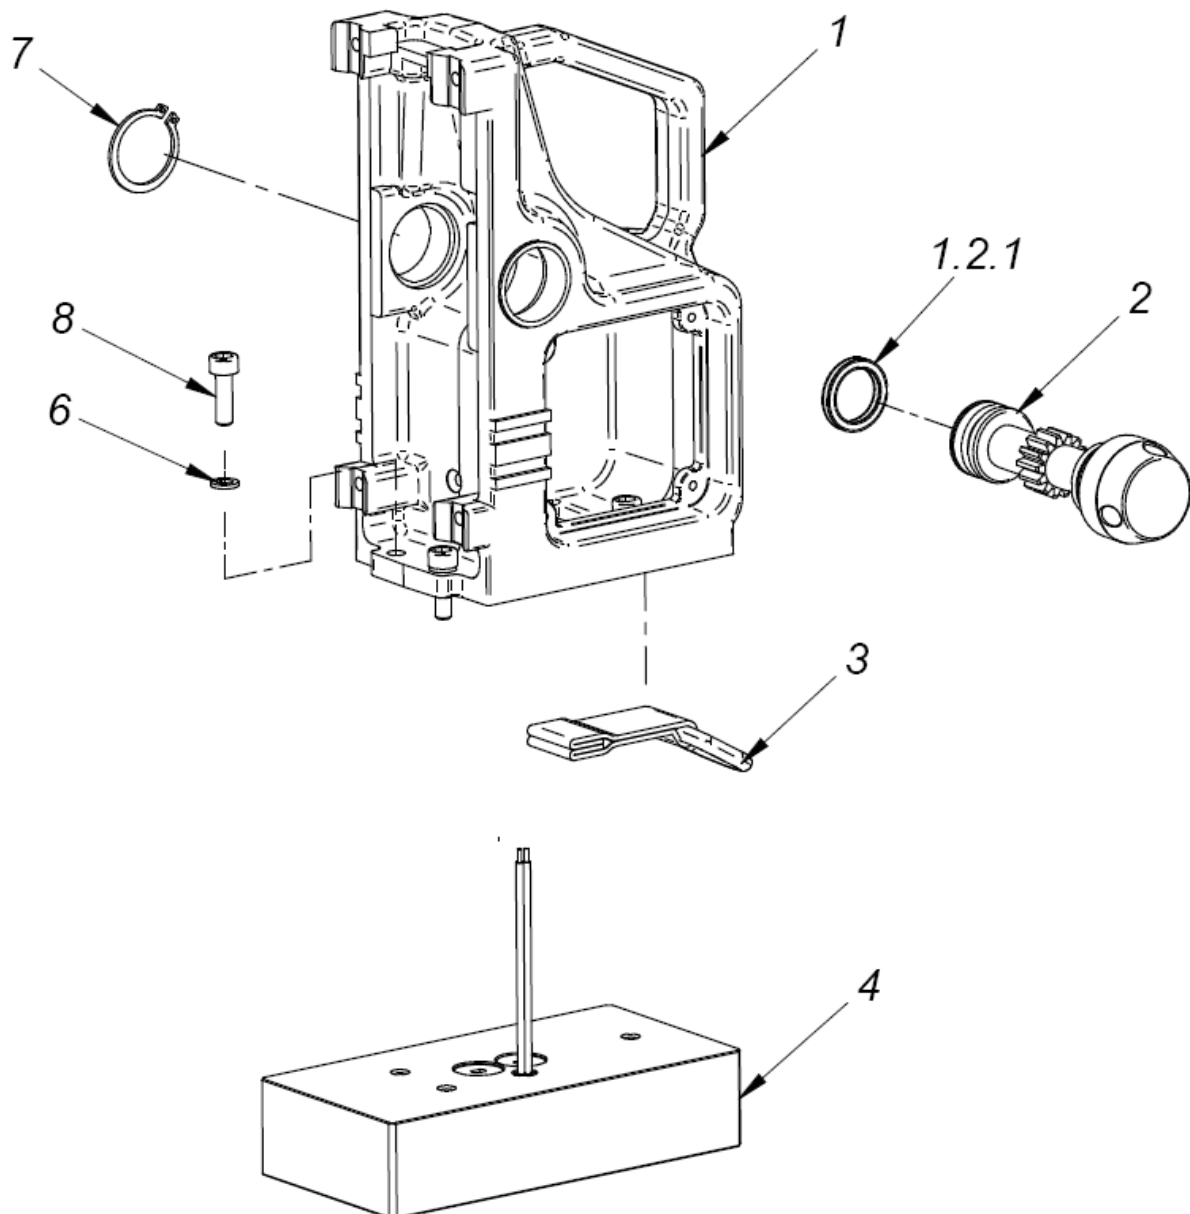


SPPRO3502		GEARBOX ASSEMBLY	
ITEM	PART NUMBER	DESCRIPTION	QTY
2.1	SPPRO350201	GEARCASE ASSY	1
2.2	SPPRO350202	MOTOR SPINDLE ASSEMBLY	1
2.3	SPPRO350203	PINION SHAFT ASSEMBLY	1
2.4	SPPRO350201	COOLANT COUPLING AMT2-H-19	1
2.5	SPPRO350205	GEAR - 52	1
2.6	SPPRO350206	DISTANCE RING	1
2.7	SPPRO350207	GUIDE	2
2.10	SPPRO350210	BEARING BALL 629 SHIELDED	1
2.11	SPPRO350211	BEARING BALL 6005 2RS	1

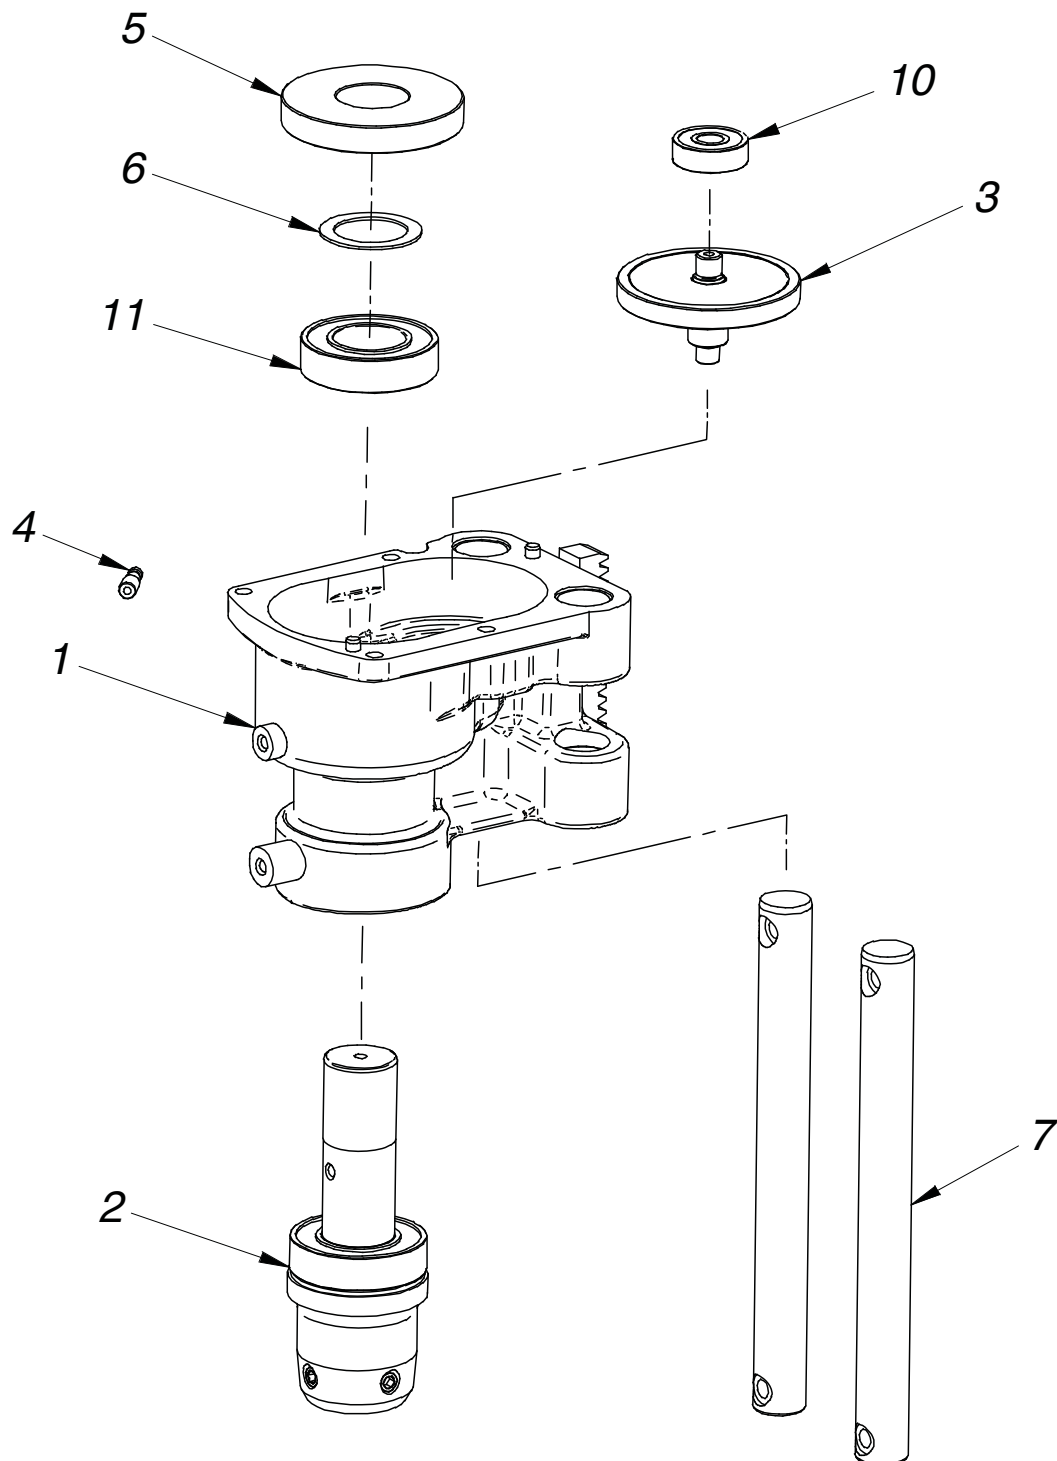


SPPRO350201		GEARCASE ASSEMBLY	
ITEM	PART NUMBER	DESCRIPTION	QTY
2.1.1	SPPRO35020101	GEARCASE	1
2.1.2	SPPRO35020102	GEAR RACK	1
2.1.3	SPPRO35020103	SELF-LUBRICATING SLEEVE 18x20x20	4
2.1.5	SPPRO35020105	BEARING 608 2Z	1
2.1.6	SPPRO35020106	SEAL 25x37x7	2
2.1.7	SPPRO35020107	DOWEL, PIN 5 x 10 MM	2
2.1.8	SPPRO35020108	DOWEL, PIN 5 x 18	1
2.1.9	SPPRO35020109	HEX. SOCKET BOLT M6X18	1

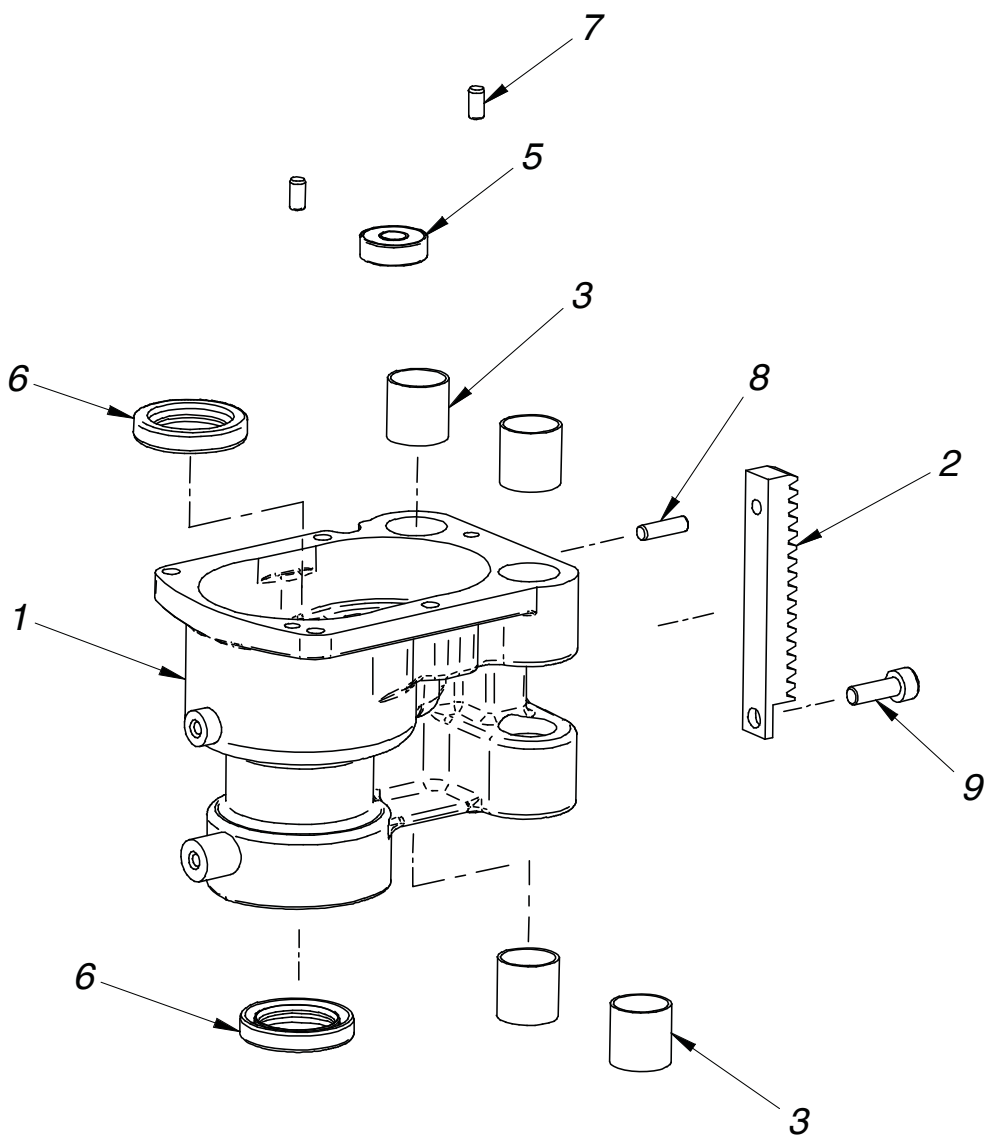


SPPRO350202		MOTOR SPINDLE ASSEMBLY	
ITEM	PART NUMBER	DESCRIPTION	QTY
2.2.1	SPPRO35020201	MOTOR SPINDLE	1
2.2.2	SPPRO35020202	PLUNGER	1
2.2.3	SPPRO35020203	SPRING	1
2.2.4	SPPRO35020204	SEAL	1
2.2.5	SPPRO35020205	INTERNAL RETAINING RING 19W	1
2.2.6	SPPRO35020206	HEX. SET SCREW M8 x 10	2
2.2.7	SPPRO35020207	BEARING BALL 6005 2RS	1

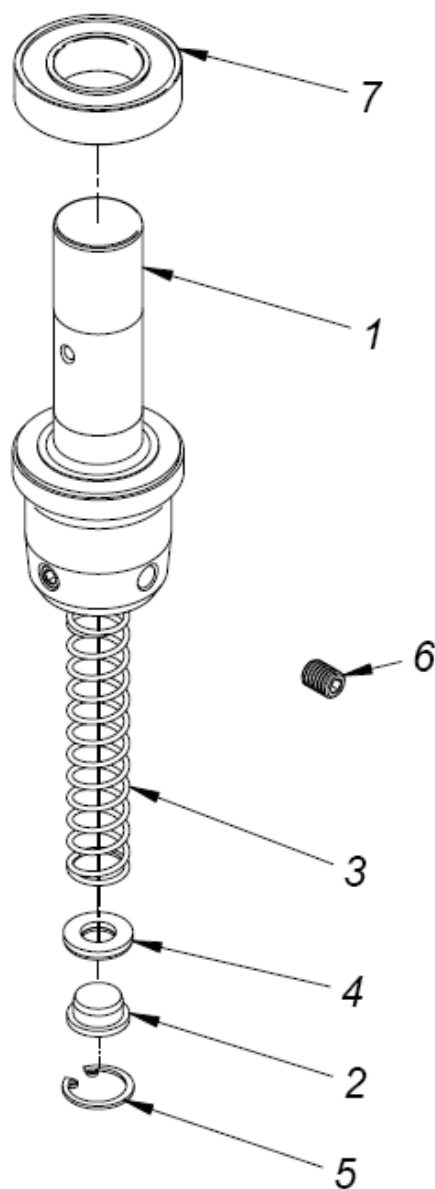


SPPRO3503		MOTOR ASSEMBLY	
ITEM	PART NUMBER	DESCRIPTION	QTY
3.1	SPPRO350301	FIELD FRAME	1
3.2	SPPRO350302	GUARD	1
3.3	SPPRO350303	MOTOR CORD	1
3.4	SPPRO350304	FIELD /230V C-34116	1
3.5	SPPRO350305	SCREW FOR PLASTIC 4x19	6
3.6	SPPRO350306	CONNECTOR 48-201-06	2
3.7	SPPRO350307	GEARBOX COVER	1
3.8	SPPRO350308	GEARBOX COVER RING	1
3.9	SPPRO350309	ARMATURE ASSY/230V C-34115	1
3.10	SPPRO350310	SPRING WASHER 4,1	2
3.11	SPPRO350311	SOCKET HEAD CAP BOLT 4x12	2
3.12	SPPRO350312	FIELD FRAME COVER	1
3.13	SPPRO350313	BRUSH HOLDER	2
3.14	SPPRO350314	MOTOR BRUSH 6x9x17,	2
3.15	SPPRO350315	BRUSH HOLDER PRESSURE PLATE	2
3.16	SPPRO350316	CROSS RECESSED PAN HEAD TAPPING SCREW 3x13	2
3.17	SPPRO350317	CROSS RECESSED PAN HEAD TAPPING SCREW 5x16	1
3.18	SPPRO350318	BEARING INSERT 19x7,5	1
3.19	SPPRO350319	SCREW FOR PLASTIC TW 5x14	2

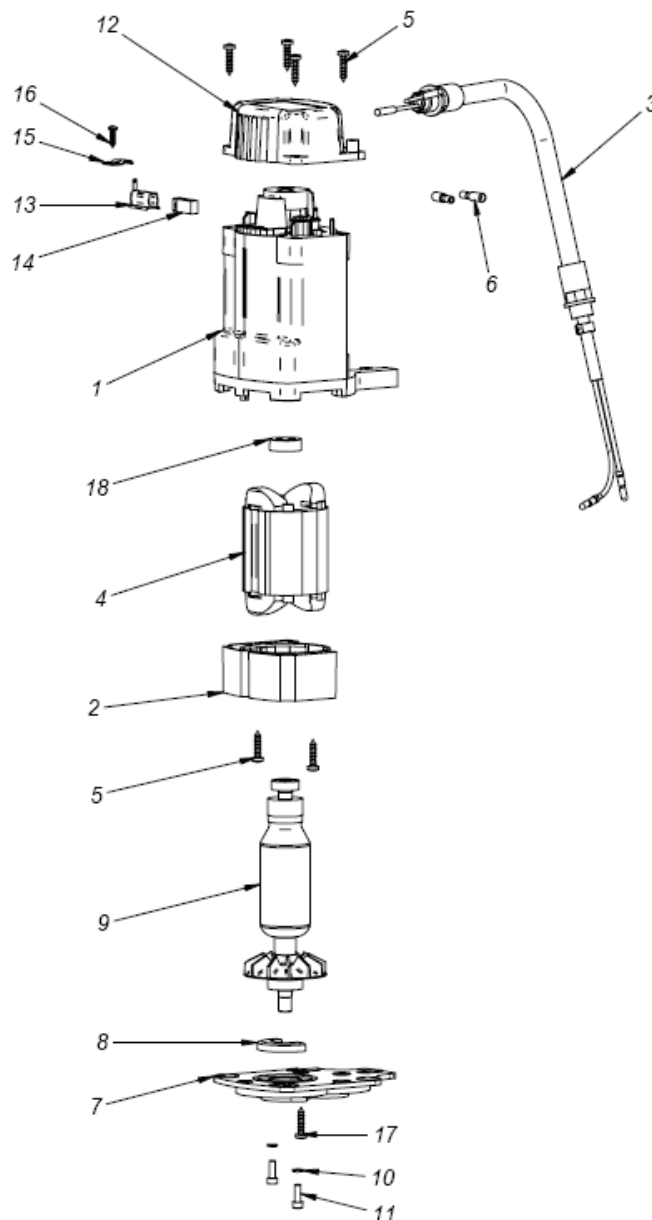

SPPRO3506		CONTROL PANEL ASSEMBLY	
ITEM	PART NUMBER	DESCRIPTION	QTY
6.1	SPPRO350601	PANEL PLATE ASSY	1
6.2	SPPRO350602	ELECTRONIC CONTROLLER SW-31M /230V	1
6.3	SPPRO350603	SWITCH START-STOP /230V,	1
6.4	SPPRO350604	SWITCH MAGNET	1
6.6	SPPRO350606	INTERFERENCE ELIMINATOR,	1

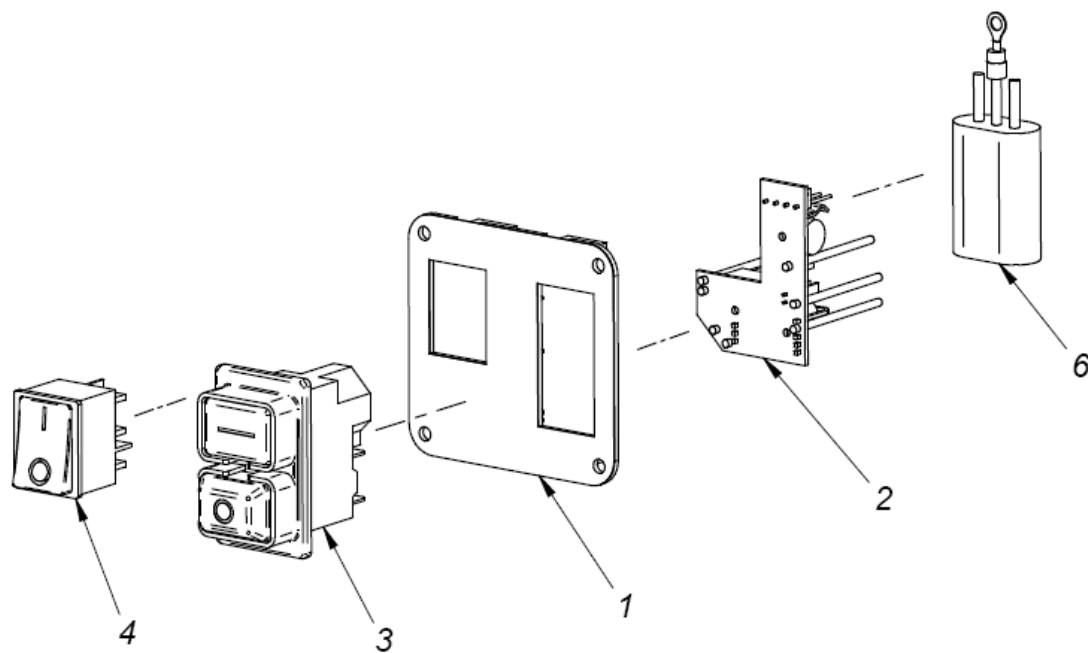

SPPRO350606

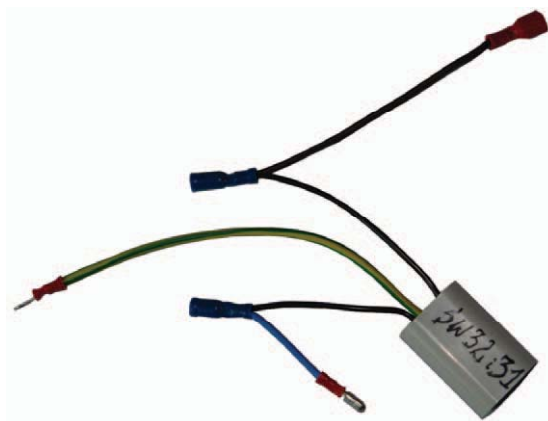

WIRING DIAGRAM

